

SERVICE BULLETIN



THE
Indian
MOTORCYCLE COMPANY

Bulletin No. SVB-156

Model ME-100A

Subject OIL TANK LEAKS

Date MARCH 28, 1974

ME-100A OIL TANK

If the oil level sight glass leaks, remove the sight glass from the oil tank. Be careful not to rip or cut the rubber seal. If the rubber seal is damaged in any way, replace it with a new sight glass (Part No. 11124113).

Sand away all imperfections and burrs on the punched hole in the oil tank.

Degrease the oil tank and the sight glass. ALL traces of oil MUST be removed from both parts. Use an electrical contact cleaner to remove the oil.

Place a "ring" of G.E. Silicone Silastic Sealer around the outside edge of the sight glass.

Pop the sight glass back into the oil tank.

Carefully lift the rubber seal from the glass eye, and smear the G.E. Sealer between the rubber and the glass. Smooth out the Sealer with your finger.

Place the oil tank back onto the motorcycle, and let dry 24 hours before filling the tank with oil.

